

Work Order ID 52790

October 14, 2009 10:43:48 AM



Page 1

Item ID: D3391-021

Accept



Setup Start



Revision ID: H

Stop



Item Name: Fwd Tube Assembly

Start Date: 14/10/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 02/11/2009 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3391	Rev H								

100

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

Cut extrusion to 46.52 +0.010 -0.020

9-10-14

110

0.00



BENDING MACHINE - SKIDTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

Bend as per Dwg D3391 Using Bend Prog 3391021

9-10-14

120

0.00



QC5- Inspect part completeness to step on W/O

QC

Memo

0.00

Quality Control

SCRAP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D3391-021 PAR #: _____ Fault Category: skid tubes NCR: (Yes) No DQA: / Date: 05-11-25
 Resolution: scrap Disposition: scrap QA: N/C Closed: / Date: 05-11-25

NCR: <u>52790</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
09.11.09	110	HEIGHT OF BEND IS 7.5" (Nom = 6.8 ± 0.25) Caused by less crushing than normal i.e. the power was compensated to the bend R.C. Process.	<u>CP</u> 09.11.09 D.S. 012	SCRAP 409.11.09	<u>[Signature]</u> 9-11-9	<u>/</u> 05-11-25	<u>/</u> 05-11-25 R.C.P.	<u>/</u> 05-11-25

NOTE: Date & initial all entries

Work Order ID 52790

October 14, 2009 10:43:49 AM



Page 2

Item ID: D3391-021

Accept



Setup Start



Revision ID: H

Stop



Item Name: Fwd Tube Assembly

Start Date: 14/10/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 02/11/2009 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 	HAAS CNC VERTICAL MACHINING #1	0.00							
HAAS 1	Memo	0.00							
HAAS CNC vertical machine #1	1-Machine as per Folio FA590 Rev. _____ & Dwg D3391 Rev. _____ Identify as D3391-1 2-Deburr								
140 	QC2- Inspect parts off machine FAI/FAIB	0.00							
QC	Memo	0.00							
Quality Control									
150 	CONVENTIONAL MILLING MACHINE	0.00							
Mill Conv	Memo	0.00							
Conventional Milling Machine	Drill X1 Aft cap as per Dwg D3391 .1875" dia								

SCRAP

Work Order ID 52790

October 14, 2009 10:43:49 AM



Page 3

Item ID: D3391-021

Accept



Setup Start



Revision ID: H

Stop



Item Name: Fwd Tube Assembly

Start Date: 14/10/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 02/11/2009 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 QC Quality Control	QC2- Inspect parts off machine FAI/FAIB Memo	0.00 0.00							
170 QC Quality Control	QC8- Inspect parts - second check Memo	0.00 0.00							

SCRAP

Work Order ID 52790

October 14, 2009 10:43:49 AM



Page 5

Item ID: D3391-021

Accept



Setup Start



Revision ID: H

Stop



Item Name: Fwd Tube Assembly

Start Date: 14/10/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 02/11/2009 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	Chemical Conversion Coat per QSI005 4.1	0.00							
	HandFinish	0.00							
	Hand Finishing								
210	QC3- Inspect Part Finish	0.00							
	QC	0.00							
	Quality Control								
220	Skidtubes	0.00							
	Skidtubes	0.00							
	Skidtubes								
	1-instal spacers as per dwg D3391 A/R Magnabond 6398 batch: _____ exp. date: _____ cure time 12hrs. as per QSI015 2- grind crossbolt flush 3-back drill crossbolt if necessary								

SCRAP

Work Order ID 52790

October 14, 2009 10:43:49 AM



Page 6

Item ID: D3391-021

Accept



Setup Start



Revision ID: H

Stop



Item Name: Fwd Tube Assembly

Start Date: 14/10/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 02/11/2009 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00							
240 Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum Memo START TIME: _____ OVEN TEMPERATURE: _____ FINISH TIME: _____	0.00 0.00							
250 QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00							

SCRAP

Work Order ID 52790

October 14, 2009 10:43:49 AM



Page 7

Item ID: D3391-021

Accept



Setup Start



Revision ID: H

Stop



Item Name: Fwd Tube Assembly

Start Date: 14/10/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 02/11/2009 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
259		0.00							
	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	**** install D3591-1 spacer as per DSI9364 ****								
260		0.00							
	Identify as per dwg & Stock Location: _____								
Packaging	Memo	0.00							
Packaging									
280		0.00							
	QC21- Final Inspection - Work Order Release								
QC	Memo	0.00							
Quality Control									

W 9.11.11

Picklist Print

Page 1

October 14, 2009 10:43:56 AM

Work Order ID: 52790



Parent Item: D3391-021RevH



Parent Item Name: Fwd Tube Assembly

Start Date: 14/10/2009

Required Date: 02/11/2009

Comments:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D6013-047RevA		Manufactured	No			100	Each	63.0000	1.0000			

Skidtube Material

Handwritten: 9-10-14

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

LG

63

23935

6

26547

57

260

Each

163.0000

4.0000

Handwritten: 1

D3670-4-200RevA

Manufactured

No



SPACER

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

SP

163

46106

4

47122

32

48198

42

48269

85

SCRAP

Picklist Print

October 14, 2009 10:43:56 AM

Work Order ID: 52790



Parent Item: D3391-021RevH



Parent Item Name: Fwd Tube Assembly

Start Date: 14/10/2009

Required Date: 02/11/2009

Comments:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D3401-041RevB		Manufactured	No			260	Each	24.0000	1.0000			
Tow Cap Assembly												

Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST

36216

41931

46029

260

Each

64.0000

1.0000

D3564-13RevD

Manufactured

No



Wearshoe

Warehouse Loc Qty Loc Code

Location

Main Warehouse

FP17

52

51611

33

52059

19

Main Warehouse

ST

12

45409

2

46495

10

Picklist Print

October 14, 2009 10:43:56 AM

Work Order ID: 52790



Parent Item: D3391-021RevH



Parent Item Name: Fwd Tube Assembly

Start Date: 14/10/2009

Required Date: 02/11/2009

Comments:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D3566-13RevC		Manufactured	No			260	Each	41.0000	1.0000			
Gasket												

AN960C10L



washer

Purchased

No

Warehouse Loc Qty Loc Code

Location

Main Warehouse

FP

51606

Main Warehouse

ST

45717

50265

260

Each

4,772.000

10.0000

Warehouse

Loc Qty

Loc Code

Location

OFFSHORE

FG

103585

Main Warehouse

ST

112116

112612

100

100

4672

1009

3663

Picklist Print

October 14, 2009 10:43:56 AM

Work Order ID: 52790

Parent Item: D3391-021RevH

Parent Item Name: Fwd Tube Assembly


Comments:

Start Date: 14/10/2009

Required Date: 02/11/2009

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
AN3C4A  BOLT		Purchased	No			260	Each	2,216.000	10.0000			

Warehouse Loc Qty Loc Code
Location

Main Warehouse

ST

112082

112314

112720

112724

112794

112829

14

10

162

300

1000

500

D3672-1RevB



Phenolic Washer

Manufactured

No

260

Each

2,060.000

4.0000

Warehouse Loc Qty Loc Code
Location

Main Warehouse

ST

1560

39275

19

42329

19

47628

522

52505

1000

Main Warehouse

ST117

500

51674

500

Picklist Print

Page 5

October 14, 2009 10:43:56 AM

Work Order ID: 52790



Parent Item: D3391-021RevH



Parent Item Name: Fwd Tube Assembly

Start Date: 14/10/2009

Required Date: 02/11/2009

Comments:

Start Qty: 1.00


Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
AELS-1032-130 		Purchased	No			260	Each	0.0000	2.0000 			
INSERT AELS-1032-225 		Purchased	No			260	Each	0.0000	10.0000 			
INSERT												

SCRAP

WITHOUT NOTICE
WORK ORDER
NO. 52720

09-10-14

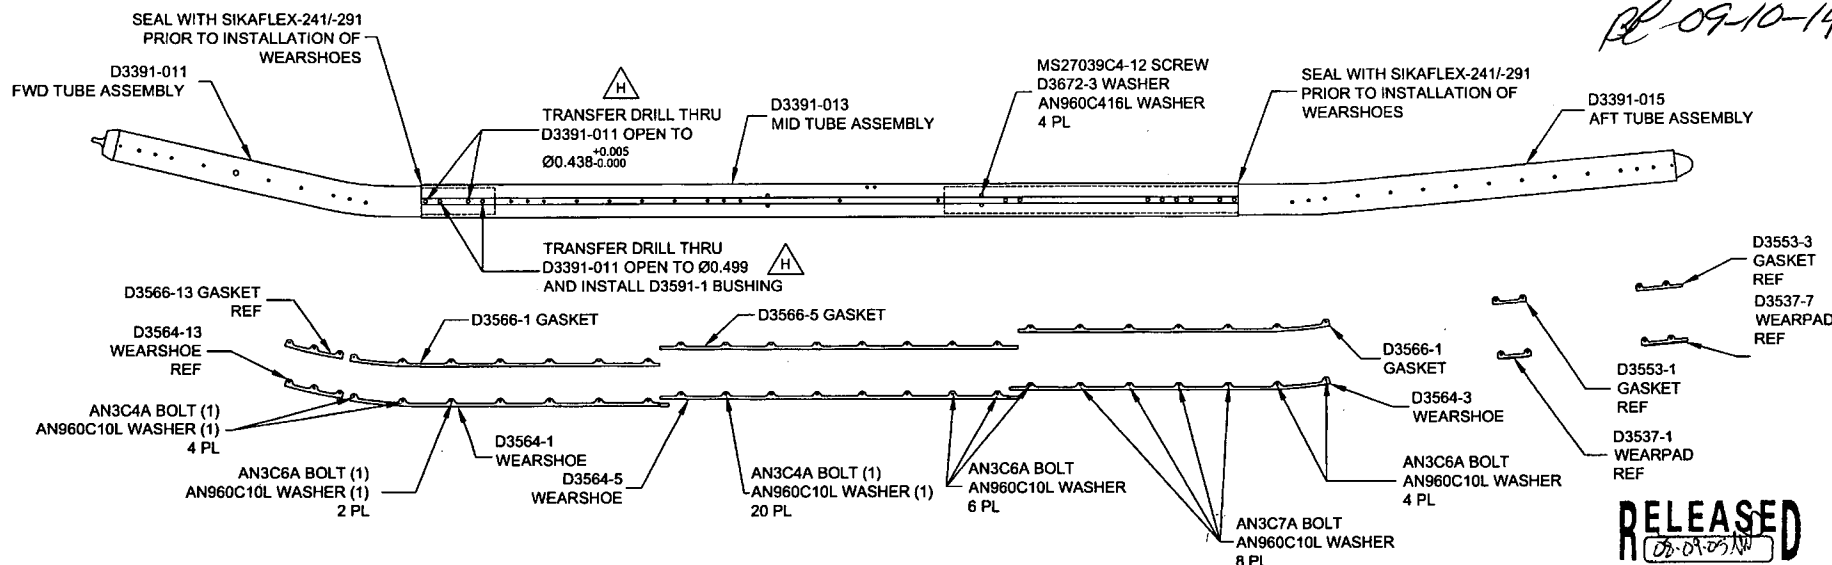

 

 
 
D3391-041 ASSEMBLY

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED, AND CONFIDENTIAL, AND IS SUBJECT TO THE FOLLOWING CONDITIONS THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O 52790

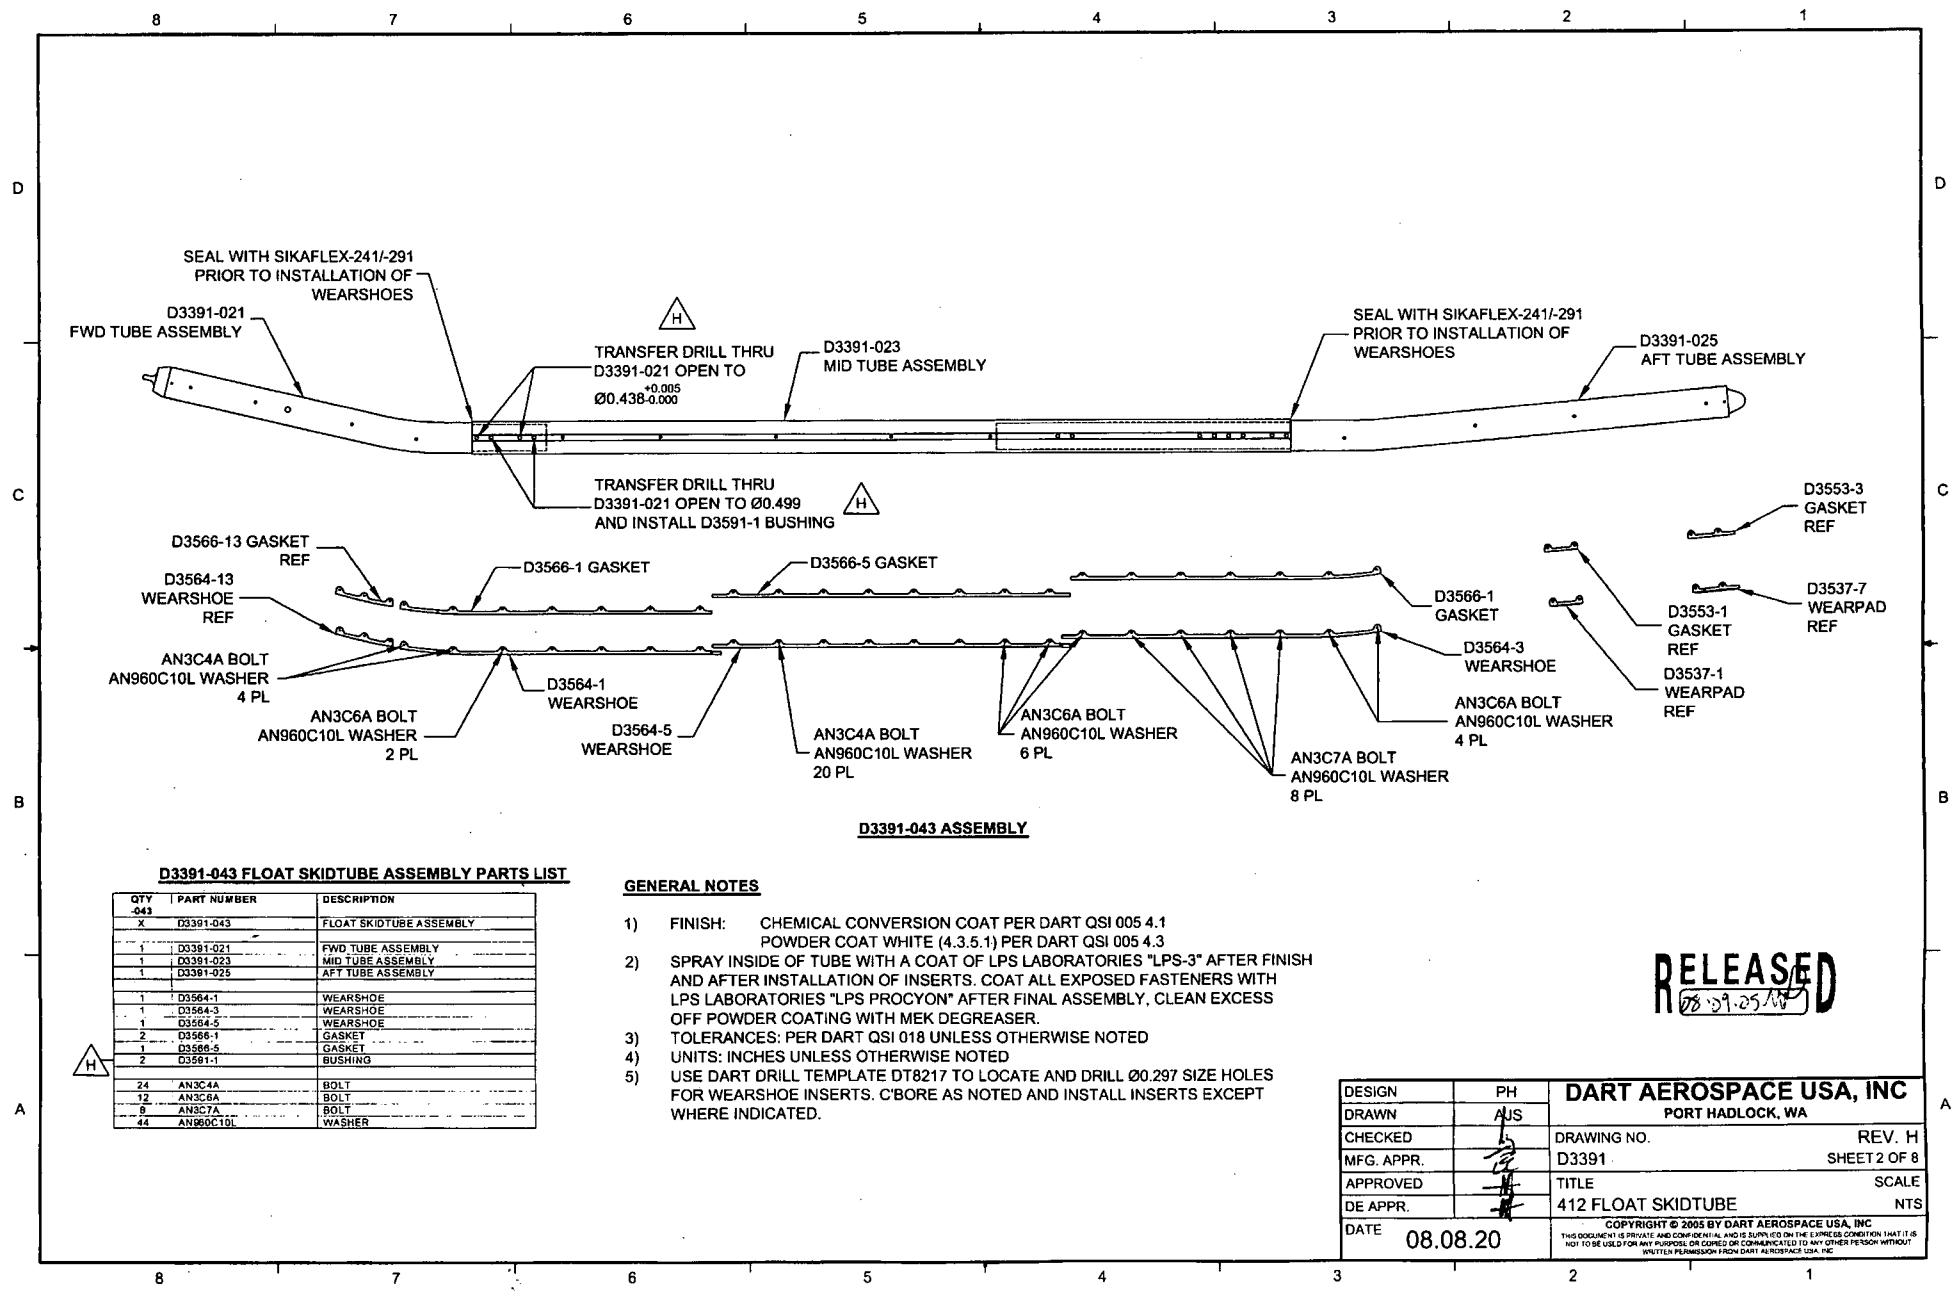

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3566-13	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
9	AN960C10L	WASHER


GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.


RELEASED
08-09-25

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


w/o 52790

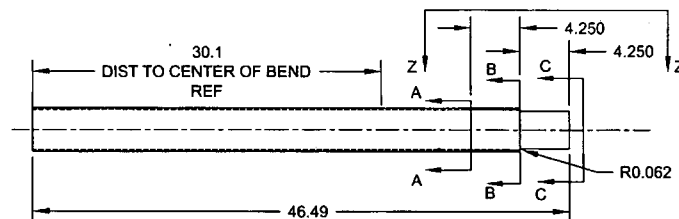


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

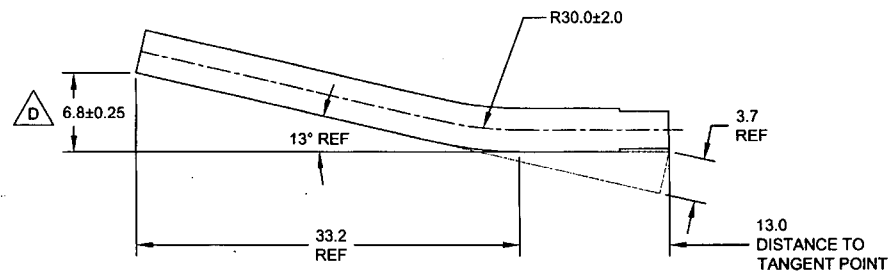


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

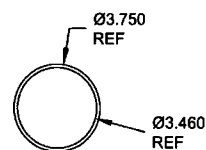


SECTION A-A
SCALE 2X

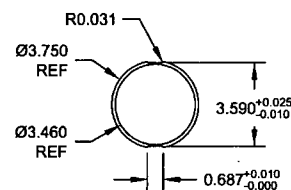

SECTION B-B
SCALE 2X

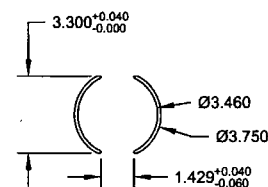

SECTION C-C
SCALE 2X

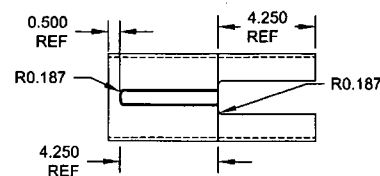


VIEW Z-Z
SCALE 2X


RELEASED
08-05-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


W/O 52790

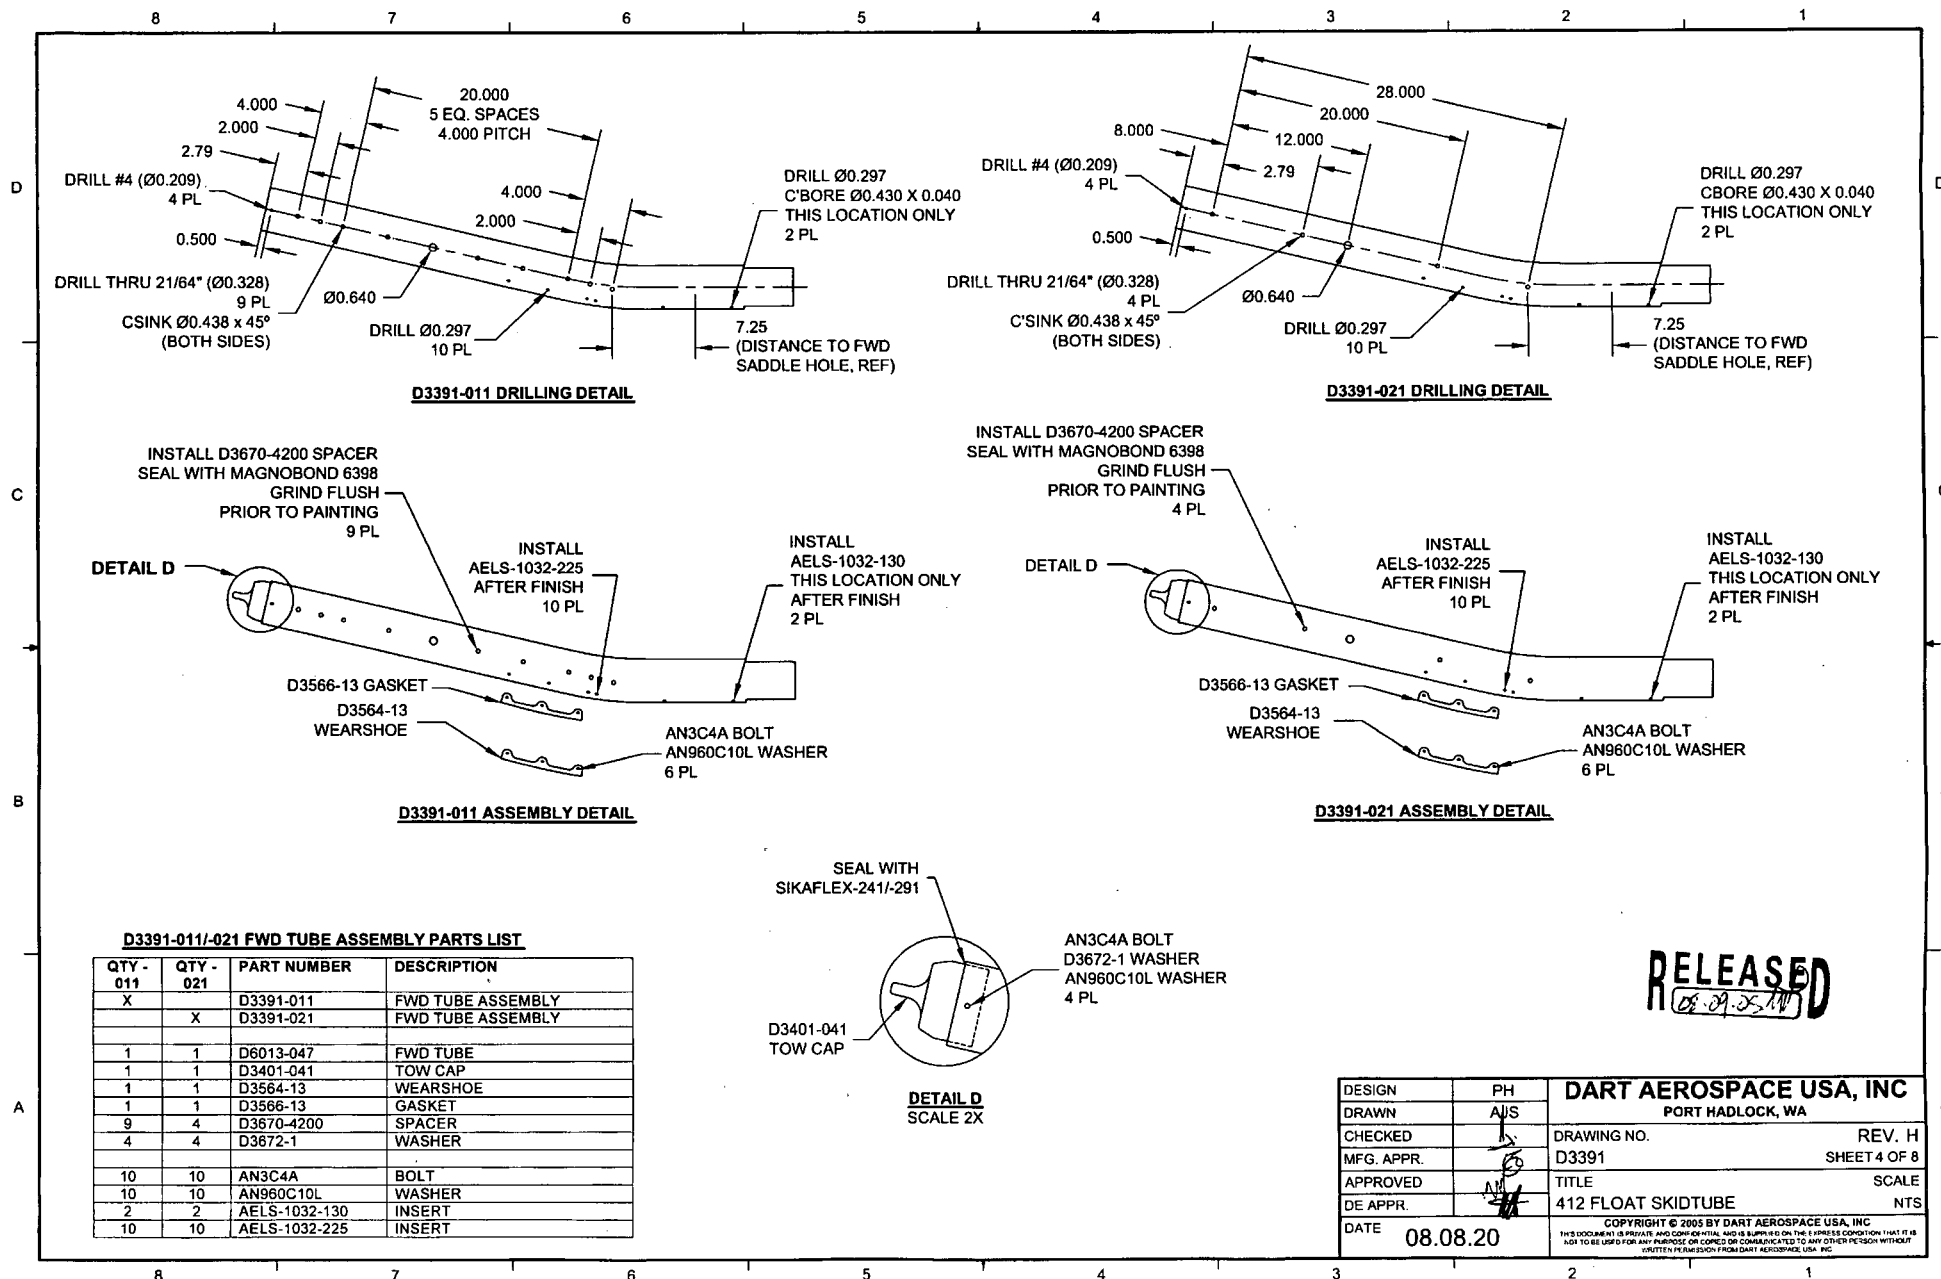


W/O 52790

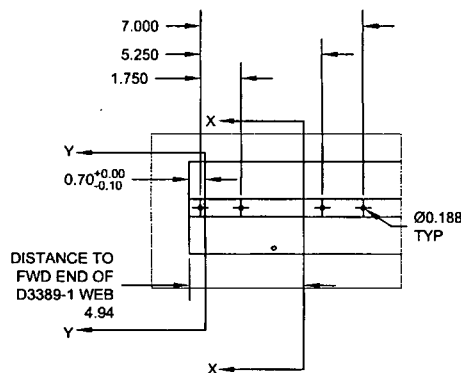

DETAIL J
SCALE 4X

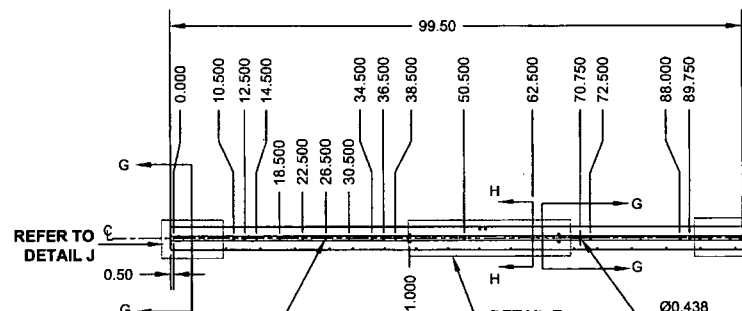


D3391-013 ASSEMBLY DETAIL

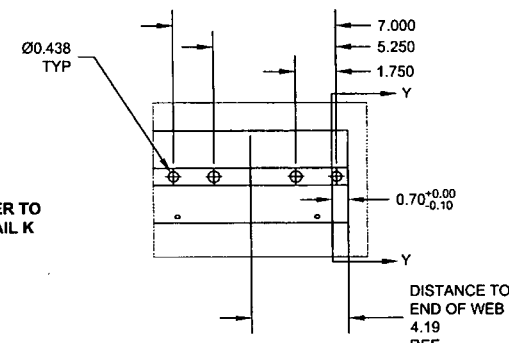


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

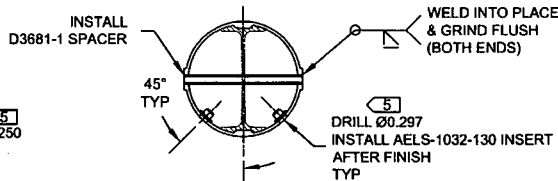

SECTION H-H
SCALE 5X

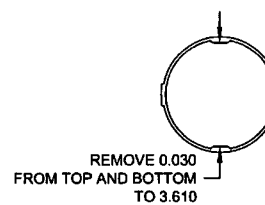


SECTION X-X
SCALE 5X

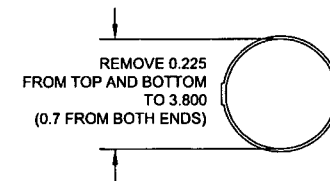


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

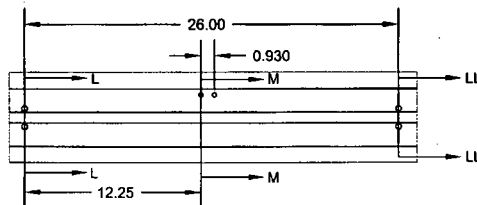


DETAIL E
SCALE NONE

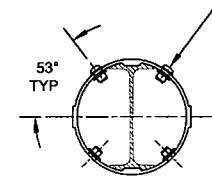


SECTION M-M
SCALE 5X

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
4 PL

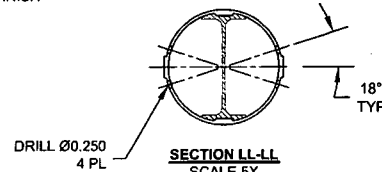

SECTION LL-LL
SCALE 5X

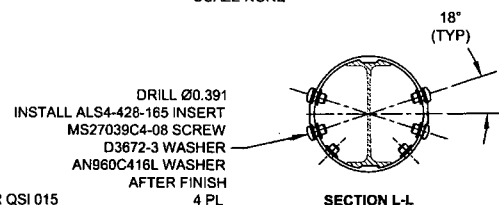

SECTION L-L
SCALE 5X


D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS UNCLASSIFIED AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED


w/o 52790

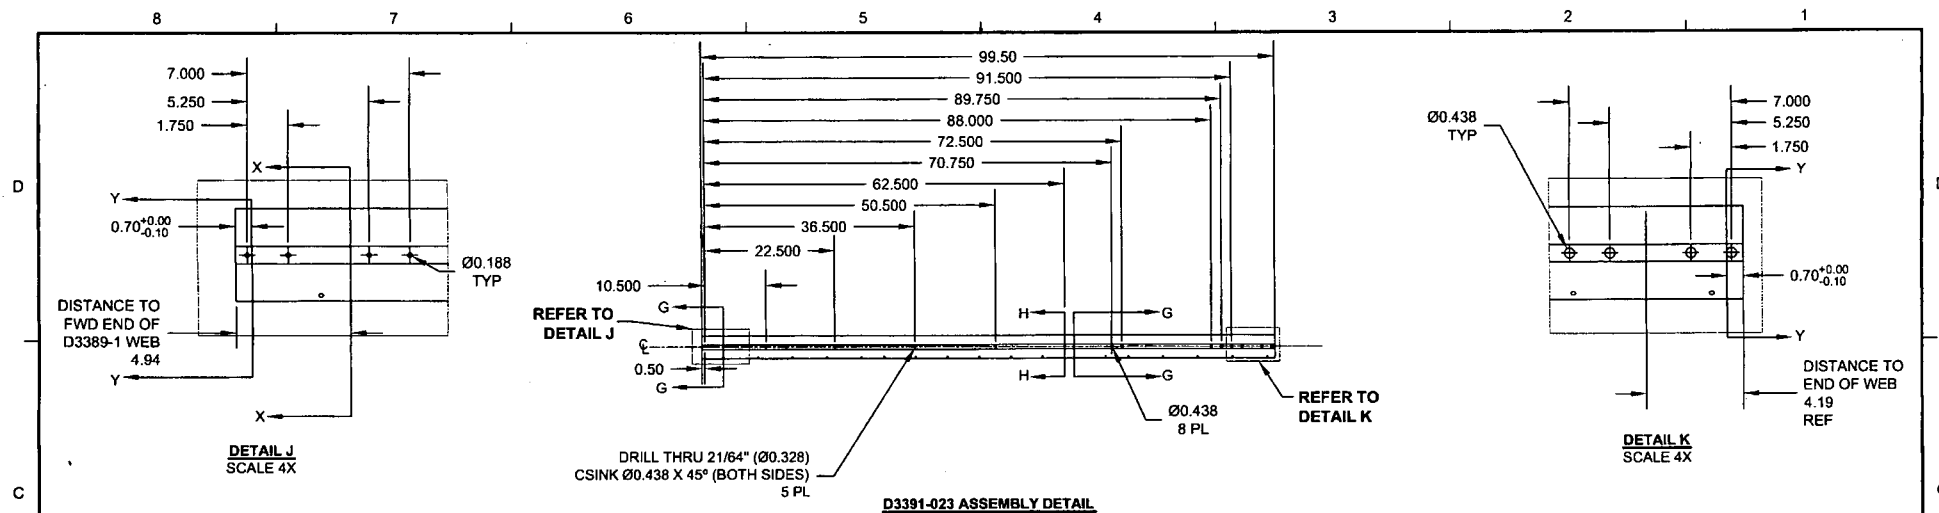


SECTION G-G
SCALE 5X

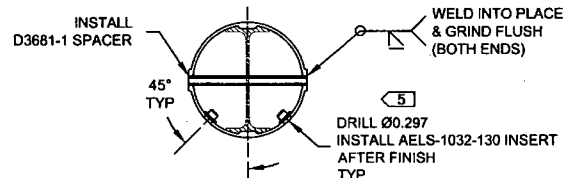

SECTION H-H
SCALE 5X

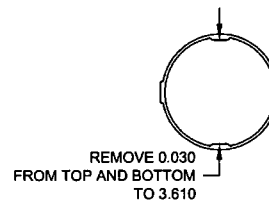

SECTION X-X
SCALE 5X

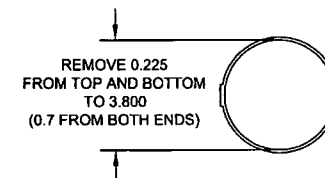

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT


D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED
08-24-05-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

u/o 52790

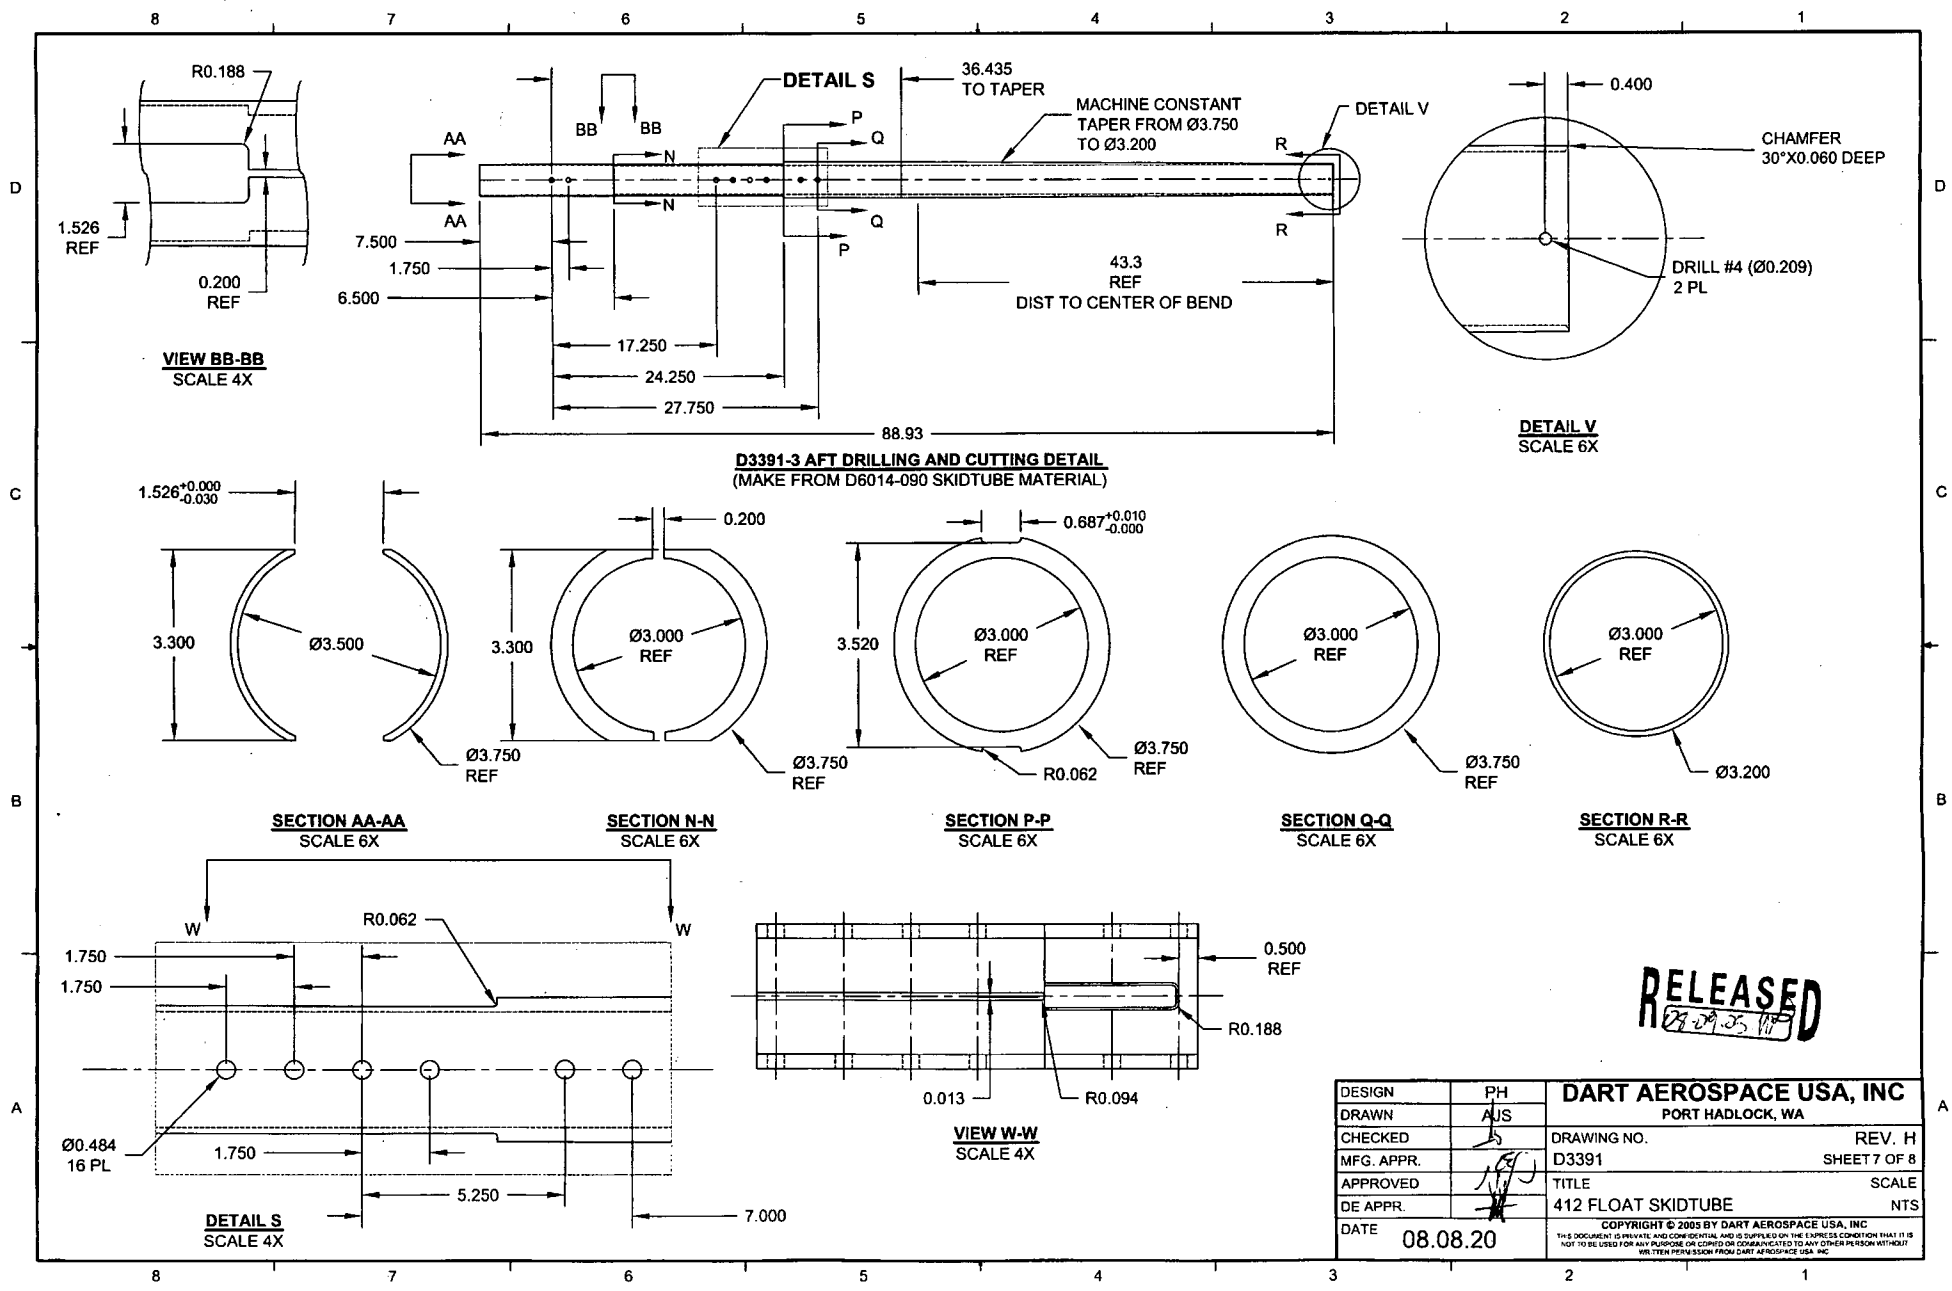

w/d 52790

